

F00VC01035 Injection Valve Set Technical File

SKU1:G1L10F00VC01035

SKU2:L10000B2BC01035

OTHER SERIES

INJECTION VALVE SET





F00VC01035 Injection Valve Set Technical File

Content

1.F00VC01035 Injection Valve Set Introduction	3
1.1.F00VC01035 Injection Valve Set Basic Information	3
1.2.F00VC01035 Injection Valve Set Application Information	3
1.3.F00VC01035 Injection Valve Set Specifications and Dimensions Parameters	
1.4.F00VC01035 Injection Valve Set Quality Control	
1.5.F00VC01035 Injection Valve Set Customized Service	4
1.6.F00VC01035 Injection Valve Set Spare Parts & Packing List	
1.7.F00VC01035 Injection Valve Set Warranty Instructions	6
1.8.F00VC01035 Injection Valve Set Storage Standard	6
2.F00VC01035 Injection Valve Set Technical Support	7
2.1.F00VC01035 Injection Valve Set Installation Precautions	7
2.2.F00VC01035 Injection Valve Set Replacement Conditions	8
2.3.F00VC01035 Injection Valve Set Technical Support Obtaining Methods	
3.F00VC01035 Injection Valve Set Purchase and Delivery	9
3.1.F00VC01035 Injection Valve Set Purchase Payment Terms	9
3.2.F00VC01035 Injection Valve Set Main Sales Market	9
3.3.F00VC01035 Injection Valve Set Declaration Requirements	9
3.4.F00VC01035 Injection Valve Set Shipping Ways	9
3.5.F00VC01035 Injection Valve Set Lead Time	9
3.6.F00VC01035 Injection Valve Set Logistics Time for Destination Out of China's Areas	9
3.7.F00VC01035 Injection Valve Set Packing	10
4. Company Information	11
4.1. Company Intstemuction	
4.2. Contact Information	11
5. Copyright Statement	11



F00VC01035 Injection Valve Set Technical File

1. F00VC01035 Injection Valve Set Introduction

The injection valve set is a critical component of the injector system, comprising the valve stem and valve cap. It is housed in the control room within the injector body and plays a pivotal role in controlling oil injection and return. This set is not only a core component but also prone to high damage rates.

Valve Cap Inspection: Use a microscope to inspect the contact surface between the valve cap and the ball for any signs of damage. If damage is detected, the valve cap should be replaced promptly.

Valve Stem Inspection:

Top of Valve Stem: Examine the top of the valve stem for any surface damage. A change in the original silver color to white indicates damage, necessitating a replacement.

Contact Area with Injector: Similarly, inspect the valve stem's contact area with the injector for surface damage. Any change from the original silver color to white indicates the need for replacement.

1.1. F00VC01035 Injection Valve Set Basic Information

Title	F00VC01035 Injection Valve Set China Made New
SKU1	G1L10F00VC01035/L10000B2BC01035

1.2. F00VC01035 Injection Valve Set Application Information

1) F00VC01035 Injection Valve Set Adapted Vehicle Information

Injector Part Number	Car Model	OE Number	OE Number	OE Number	OE Number	OE Number
	AUDI	057 130 276 H	Large com		priection values of con-	
0 445 110 113	VW (VOLKSWA GEN)	057 130 276 H	/	/	/	/
	AUDI	057 130 276 H				
0 445 110 114	VW (VOLKSWA GEN)	057 130 276 H		/	A continues and a	/

2) F00VC01035 Injection Valve Set Adapted injector Information

Injector Series	Injector Part Number	System Pressure	Re-manufactured Part Number	System Pressure	Universal Number	System Pressure
CRI1-13	0 445 110 113	/	/	/	0 445 110 114	1035
CRI1-13	0 445 110 114	1035	1	1	0 445 110 113	/

3) F00VC01035 Injection Valve Set Part Number Common Writing

1.3. F00VC01035 Injection Valve Set Specifications and Dimensions Parameters

Injection Valve Set Size: 13 cm*2 cm *2 cm
Injection Valve Set Box Size: 14 cm *3 cm *3 cm
Injection Valve Set Packing Size: 31 cm *12 cm



Injection Valve Set Net Weight: 0.03kg
Injection Valve Set Gross Weight: 0.03kg
Injection Valve Set Quality: China Made New

Injection Valve Set MOQ: 4PC

1.4. F00VC01035 Injection Valve Set Quality Control

1) Injection Valve Set Testing

All parts of the injection valve set have undergone precision testing, high temperature testing, low temperature testing, withstand pressure testing, leakage testing, durability testing, and various working conditions testing.

2) Injection Valve Set Inspection

The factory inspection of the injection valve set is undergone three inspections: full inspection, random inspection, and batch inspection. Different brands of test benches are used to test the same injection valve set for more than three times for factory inspection, and the injection valve set 's installation and testing environment are progressed in dust-free workshop.

3) Injection Valve Set Installation

When matching the valve cap and valve steam, Shumatt strictly complies with the standard of valve cap and valve stem clearance technical indicators to ensure that each injection valve set meets the factory standards and use standards.

1.5. F00VC01035 Injection Valve Set Customized Service

1) Injection Valve Set Customized Service Coverage: Meet the customized needs of OEM manufacturers for valve color and lustre, valve cap groove customization, valve cap lettering ,valve cap logo engraving, valve cap QR code engraving, injection valve set internal packaging, injection valve set external packaging and label customization needs.

No.	1	2
Image		
Name	Valve Cap Color And Lustre	Valve Cap Color And Lustre
Description	Customized 1000 pieces (white color is optional)	Customized 1000 pieces (purple red color is optional)
No.	3	4
Image		S. S
Name	Valve Cap Groove Customization	Valve Cap Lettering, Logo Engraving, QR Code Engraving Customization
No.	5	6
Image		
Name	Valve Set Box	Valve Set Box
Description	Rectangle is optional	Cylindrical is optional



No.	7	8
Image	VCI VCI	SHUMATT F00/C01379 Common rail Page Application: 0445110354 O445110424 F20000238C01379 Market (2022 Perm) Market (2022 Perm)
Name	Valve Set Bag	Valve Set Label 7cm*5cm

2) Injection Valve Set Customized Service Requirements:

The purchase of customized injection valve set package is no less than 100 pieces.

The purchase of customized valve set groove is no less than 100 pieces.

The purchase of customized valve set is no less than 1000 pieces.

The purchase of customized valve cap engraving is no less than 1000 pieces.

The purchase of customized valve color is no less than between 1000 -10000 pieces.

▲ When the customized Service involve the need of specify logo, the OEM manufacturer is asked to provide trademark authorization and the sample of logo image file.

• Once the customized injection valve set is sold, it can not be returned or exchanged if there is no quality problems.

1.6. F00VC01035 Injection Valve Set Spare Parts & Packing List

No.	1	2
Image	aintenage	
Name	Injection Valve Set	Injection Valve Set Anti-rust Paper
Description	Injection valve set part number F00VC01035	Prevent the injection valve set from rusting
No.	3	4
Image		a Nector & Court
Name	Injection Valve Set Box (Rectangle)	Injection Valve Set Box (Cylindrical)
Description	Protect the injection valve set from being damaged by colliding	Protect the injection valve set from being damaged by colliding
No.	5	6
Image	VCI 10XV	/
Name	VCI Anti-rust Bag	/
Description	Prevent the injection valve set from rusting	, marsana



Minors are prohibited from using the injection valve set, valve set anti-rust paper, valve assembly box, and VCI anti-rust bag to avoid personal injury.

The Valve Set box is recyclable and can be reused.

VCI anti-rust bag is non-degradable material, please dispose of it properly after use.

1.7. F00VC01035 Injection Valve Set Warranty Instructions

Injection Valve Set Warranty Conditions and Instructions

It is necessary to provide pictures, videos, or test reports detected by the injection valve set inspection equipment when the valve set is abnormal during use as evidence to feed back to the salesman.

Abnormal conditions are properly explained such as:1.Smoke, 2. Engine shake, 3. Difficulty starting the engine, 4. Engine noise, 5.0il leakage and other abnormal conditions.

The above condition may also be affected by other components of the injector. If it is confirmed by our company to be a product problem, it is within the scope of the subsidy.

Injection Valve Set Warranty Coverage

Within 15 days after customer receives the F00VC01035 injection valve set, if there is a performance failure and the product has no appearance damage, customer can choose to replace it;

If theF00VC01035 injection valve set has performance problems during the warranty period (6-12 months), and it is confirmed that it is product's problems after being tested, you can contact our salesmen to replace the same model for free;

If the product is confirmed to be fault-free, the product will be returned.

Injection Valve Set Out of Warranty Coverage

- 1 The warranty period has expired, not covered by warranty.
- ② Injection valve set failure caused by high temperature, high pressure, humidity, rain and snow, saline-alkali land, earthquake, and used in abnormal environment.
- Injection valve set damage caused by man-made reasons (throwing, strong magnetic field magnetization, set fire).
- Injection valve set failure or injector damage caused by non-injector design, technology, manufacturing, quality and other issues.
 - Injection valve set failure due to system pressure exceeding system approved pressure.
- Injection valve set failure caused by impurities (water, lead, aluminum powder, iron powder, sulfide) in the system fuel exceeding the standard requirements.
- Injection valve set failure caused by not installing according to the tightening torque specified in the vehicle engine maintenance manual (the tightening torque is too large or too small).
- Injection valve set failure caused by not following the installation angle specified in the injector maintenance manual.
- Injection valve set failure caused by not following the cleaning requirements specified in the injector maintenance manual.
- Injection valve set failure caused by failure to replace consumable parts as specified in the injector maintenance manual.

1.8. F00VC01035 Injection Valve Set Storage Standard

Choose a Suitable Storage Place

The warehouse and cargo yard where the fuel injection valve set is stored should be kept clean and dry, and away from the factory buildings that generate harmful gases and dust; do not mix with acid, alkali, salt and other substances; the storage place should have a good drainage system; the cargo yard should be flattened with gravel or furnace ash etc. to enhance the water permeability of the surface layer to keep the reservoir area dry.

Strict Requirements of Warehousing

Strict inspections should be carried out when the fuel injector valve assemblies are put into storage, the surface cleaning work should be done well to remove water traces, oil stains, ash and other dirt, remove the rust and do anti-rust treatment in time. Packaged injection valve set must be protected from damage.



3) Keep The Warehouse Dry And Preventing Moisture

The relative humidity is usually below 70% for the fuel injector Valve Set placed in the room, and the corrosion of the fuel injection valve set is significantly reduced.

Injection valve set must be stored in the warehouse, and they are forbidden to store in the same warehouse with commodities with high water content.

4) Stack Properly

After the injection valve set is exposed to rain, the corrosion rate will increase significantly. The purpose of sealing is to isolate the injection valve set from rainwater and humid air, so the warehouse window should be checked in time to avoid rainwater entering the warehouse

If the injection valve set package is damaged, it should be repaired or replaced; when the package is damp, the packaging material should be dried; if the original anti-corrosion and oil applied at the factory is found to be damaged or dried up, it should be cleaned and re-applied oil in time.

A It is forbidden to leave the injection valve set exposed in the air for a long time.


A It is forbidden to store acid, alkali, salt and other substances together with the injection valve set.

▲ The unpacked injection valve set must be rust-proof during secondary storage.

2. F00VC01035 Injection Valve Set Technical Support


2.1. F00VC01035 Injection Valve Set Installation Precautions

- Clean the injection valve set in an ultrasonic cleaner for 3-5 minutes before installation, so as to make the stains, dust, rust-proof oil oxides, paraffin base, naphthenic base, intermediate base, salt, lead naphthenate, zinc naphthenate, sodium petroleum sulfonate, barium petroleum sulfonate, calcium petroleum sulfonate, tallow diamine trioleate, rosinamine on the surface of the injection valve set fall off.
- 2) Use compressed air to clean the cleaning fluid attached to the surface of the injection valve set after cleaning, and clean it up to the standard of use.
- 3) When installing the steel ball and ball seat, pay attention to the steel ball should close tightly to the oil return hole at the top of the valve cap, as shown below:

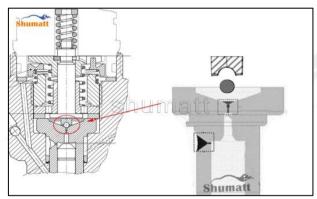

Pic No.1

4) When installing the valve stem, make sure that the valve stem and the bonnet must ensure that the valve stem can move smoothly in it, as shown below:

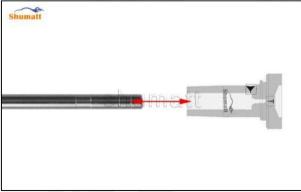

Pic No.2



When installing the injection valve set, the oil inlet position should be 180° between the oil inlet position of the injector body.

If the injector steel ball and the ball seat are not installed in accordance with the standard, it may cause serious damage to the injection valve set.

2.2. F00VC01035 Injection Valve Set Replacement Conditions

1) Valve Cap

Under the microscope, magnify 20 times to check that the oil inlet hole of the valve cap and the oil return hole of the bonnet are not worn, grooved, scratched, damaged, rusted or dented.

No.	1	2	3
Image			
Descripti	on Injection valve cap oil inlet hole location	Injection valve cap oil return hole location	The oil inlet and oil return holes of the injection valve cap are free of wear, grooves, scratches, damage, rust, dents, which do not need to be replaced
No.	4	5	6
Image		0	Shamin
Descripti	The injection valve cap oil hole is recessed and needs to be replaced	The injection valve cap oil hole is worn and needs to be replaced	The injection valve cap oil hole is punched and needs to be replaced

⚠ The wear of the top oil return hole causes the oil return to be too large and the leaking injector cannot inject oil.

The oil inlet hole on the side is blocked, causing the injector to fail to establish the pressure chamber and the injector cannot work normally

Mear of the oil chamber of the valve cap will cause fuel injector failure. In severe cases, the fuel injector will not work properly.

2) Valve Stem

Magnify 20 times under a microscope to check whether the valve stem is worn, the surface is not smooth, discolored, or rusty.

No.	1	2	3
Image			
Description	The valve stem is worn out and needs to be replaced	The valve stem surface is not smooth and colorless, and it needs to be replaced	The valve stem is rusty and needs to be replaced





The excessive clearance between the valve stem wear, housing and the valve cap will causes injector lag.

 $oldsymbol{\mathbb{A}}$ The valve stem lag will cause the injector to start the solenoid to start, and the oil needle can not return quickly after the nozzle is opened.



⚠ Check the injector components before replacing the injection valve set according following the injector service manual to avoid further damage to the injection valve set after replacement.

2.3. F00VC01035 Injection Valve Set Technical Support Obtaining Methods

- Injection Valve Set Technical Data: https://www.injectionvalveset.com/download/
- Injection Valve Set Videos: https://www.injectionvalveset.com/videos/ 2)
- Injection Valve Set Encyclopedia: https://www.injectionvalveset.com/categorv/news/encyclopedia/

3. F00VC01035 Injection Valve Set Purchase and Delivery.

3.1. F00VC01035 Injection Valve Set Purchase Payment Terms

Payment Terms: T/T, PayPal, Alipay, WeChat



A Please contact our salesmen for specific payment information.

3.2. F00VC01035 Injection Valve Set Main Sales Market.

Injection Valve Set main sales markets: Asia, Europe, North America, South America, Africa etc.

3.3. F00VC01035 Injection Valve Set Declaration Requirements

We can assist customers to provide the following documents for import customs clearance: contract, invoice, packing list, bill of lading, insurance policy, certificate of origin, etc.

3.4. F00VC01035 Injection Valve Set Shipping Ways

Destination in China areas: SF Express, Debon Express, the corresponding logistics company can be provided according to customer requirements in special cases.

Destinations out of China's areas: DHL, UPS, FedEx, TNT air, ocean or other shipping methods required by customers.

3.5. F00VC01035 Injection Valve Set Lead Time

Lead time: Send out within 3 - 7 working days after receiving payment(Except for special products and special cases).

3.6. F00VC01035 Injection Valve Set Logistics Time for Destination Out of China's Areas

DHL Logistics Time:

Country or Region of Departure	Hong Kong, China	Other Countries or Regions of Asia	Australia and New Zealand	Europe	America	Other Countries
China's Mainland	7 Days	7 Days	8 Days	8 Days	8- 12 Days	7-10 Days

UPS Logistics Time: Country or Region of Departure: China's Mainland

Country of Destination	Estimated Arrival Time	Country of Destination	Estimated Arrival Time	Country of Destination	Estimated Arrival Time
Japan	3 Days	UK	5-7 Days	Egypt	5-7 Days
Turkey	5-7 Days	Singapore	3 Days	Switzerland	5-7 Days
Bahrain	5-7 Days	Latvia	7-10 Days	New Zealand	7-10 Days
Sri Lanka	5-7 Days	Thailand	3 Days	Austria	5-7 Days
Romania	5-7 Days	Vietnam	3-5 Days	Estonia	5-7 Days
Malaysia	3-5 Days	Israel	5-7 Days	Mexico	7-10 Days



5-7 Days	America	5-7 Days	United Arab Emirates	5-7 Days
5-7 Days	Netherlands	5-7 Days	Bengal	7-10 Days
5-7 Days	Philippine	3-5 Days	Greece	7-10 Days
3 Days	Spain	5-7 Days	Myanmar	5-7 Days
5-7 Days	Germany	5-7 Days	Saudi Arabia	7-10 Days
5-7 Days	Australia	5-7 Days	South Africa	7-10 Days
5-7 Days	Belgium	5-7 Days	Ukraine	7-10 Days
7-10 Days	Qatar	7-10 Days	Poland	5-7 Days
3-5 Days	Morocco	7-10 Days	Pakistan	7-10 Days
7-10 Days	/	/	/	/
	5-7 Days 5-7 Days 3 Days 5-7 Days 5-7 Days 5-7 Days 7-10 Days 3-5 Days	5-7 Days Netherlands 5-7 Days Philippine 3 Days Spain 5-7 Days Germany 5-7 Days Australia 5-7 Days Belgium 7-10 Days Qatar 3-5 Days Morocco	5-7 Days Netherlands 5-7 Days Philippine 3-5 Days 3 Days Spain 5-7 Days 5-7 Days 5-7 Days Germany 5-7 Days 5-7 Days Australia 5-7 Days 5-7 Days Belgium 5-7 Days 7-10 Days Australia 7-10 Days Morocco 7-10 Days	5-7 Days Netherlands 5-7 Days Bengal 5-7 Days Philippine 3-5 Days Greece 3 Days Spain 5-7 Days Myanmar 5-7 Days Germany 5-7 Days Saudi Arabia 5-7 Days Australia 5-7 Days South Africa 5-7 Days Belgium 5-7 Days Ukraine 7-10 Days Qatar 7-10 Days Poland 3-5 Days Morocco 7-10 Days Pakistan



⚠ The logistics time is for reference only and is subject to the actual arrival.

3.7. F00VC01035 Injection Valve Set Packing

Domestic Express Packaging: Usually wrapped in waterproof scotch tape, such as picture No.1. International Express Packaging: Wrapped with waterproof yellow tape After wrapping the black protective film, such as picture No. 2.

Pallet Shipping: Use fumigation free and recycling trays that meet export requirements, and use white wrapping protective film to wrap and bind with cable ties for the outside, such as picture No. 3, Also, the products can be packaged according to customers' requirements.



⚠ The packing tray is made of plastic and can be recycled.



⚠ Transparent tape, yellow tape, black wrapping protective film, white wrapping protective film are non-degradable materials, please dispose of them properly.



A Minors are prohibited from using transparent tape, yellow tape, black wrapping protective film, and white wrapping protective film to avoid personal injury.

No.	Image	Name	Description
1		Domestic Express Packaging	Wrapped by Transparent tape
2		International Express Packaging	Wrapped with yellow tape after wrapping black protective film
3	CANADI AND	Pallet Shipping	Use pallet that meet export requirements, and use white wrapping protective film to wrap and bind with cable ties

Website: www.injectionvalveset.com © 2025 www.injectionvalveset.com

4. Company Information



Pic No.3

4.1. Company Intstemuction

☐ Mob Phone/WeChat: +86-13410541523

☐ HK Telephone: +852-67653519

Telephone: +86-755-23215133

Shenzhen Office: 11-12, Floor 14, Building 13, Qinchengda Building, Exit A, Honglang North Subway

Station, Bao'an District, Shenzhen, China's Mainland

Shenzhen Office: Exit C, Qiao Touxi Metro Station, NO. 66 Chongqing Road, Fuhai Avenue, Bao'an District,

Shenzhen, China Mainland

Hong Kong Office: Jianfa Street Industrial Zone, Tuen Mun, New Territories, Hong Kong, China

After-sales Service Address: Please contact our salesmen to obtain and provide the corresponding product maintenance reasons (Reference: 1.7.F00VC01035 Injection Valve Set Warranty Instructions.)

4.2 Contact Information

T.2. Contact information		
Name	WeChat/ WhatsApp	
Ruby	+86-13410541523	

5. Copyright Statement

The content on this file "FOOVCO1035 Injection Valve Set Technical File", including text, graphics, images, logos, and any other material, is protected under copyright law and remains the exclusive property of Shenzhen Shumatt Technology Co., Ltd. The content is made available for your personal, non-commercial use only. You are expressly prohibited from copying, reproducing, redistributing, modifying, publishing, transmitting, or using the content for commercial purposes without the prior written consent. Shenzhen Shumatt Technology Co., Ltd reserves the right to modify this copyright notice at any time. By continuing to access the site after such modifications, you agree to be bound by the revised notice.